



NUMBER: 14-002-09

GROUP: Fuel

DATE: August 1, 2009

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Hard to Fill With Fuel Or Must Fill Fuel At Very Slow Rate

OVERVIEW:

This bulletin involves replacing the vent line tube, vent line filter, vent line and recirculation line.

MODELS:

2007 - 2009 (JK) Wrangler (International Markets)

NOTE: This bulletin applies to JK vehicles equipped with a 2.8L diesel engine (sales code ENS) built before January 16, 2009 (MDH0116XX).

SYMPTOM/CONDITION:

Customer may describe a condition where they are unable to completely fill their vehicles with fuel or that they must fill the vehicle at a very slow rate. This condition is caused by the vent system not being able to provide enough tank ventilation.

The updated parts corrects this condition.

DIAGNOSIS:

If the vehicle operator describes or experiences the Symptom/Condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	68012168AA	Filter, Vent
1 (52126039AB	Tube, Vent
1	52125187AB	Line, Vent
1	52059778AC	Line, Recirculation
1	J3693058	Tie-strap 24 tie-straps in one package, 4 required per vehicle
1	NPN	Screw, 1/4" Sheet Metal



Stick with the Specialists™

REPAIR PROCEDURE:

1. Remove the fuel filler neck.
2. Remove the vent line extension from the fuel filler neck and fuel tank. Discard the vent line extension.
3. Cut 2 tie-straps and remove the recirculation line from the fuel filler neck extension and fuel tank. Discard the recirculation line.
4. Drill out the rivet holding the filter to the fuel filler neck. Discard filter.
5. Cut 2 tie-straps holding the vent tube to the fuel filler neck. Discard vent tube.
6. Using self tapping 1/4" sheet metal screw attach the new filter (p/n 68012168AA) to fuel filler neck.
7. Install vent tube (p/n 52126039AB) on filter and tie-strap tube to the fuel filler neck in 2 spots.
8. Install filler neck assembly in vehicle.
9. Install recirculation line (p/n 52059778AC) on fuel filler extension by tie-strapping it in 2 locations and connect to fuel tank.
10. Install the vent line extension, (p/n 52125187AB), and attach to fuel filler neck and fuel tank.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
25-01-17-92	Repair, Vent System (B)	1.1 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------